.500

RECOMMENDED

HOLE SIZE

Ø.510

IMPEDANCE: 50 OHMS NOMINAL

VSWR: 1.2:1 MAXIMUM DC TO 2GHz

INSERTION LOSS: .1dB MAXIMUM DC TO 2GHz WORKING VOLTAGE: 500 VRMS @ SEA LEVEL

TEMPERATURE RATING: -65° TO +165° C

VIBRATION: MIL-STD-202, METHOD 204, COND. I

SHOCK: MIL-STD-202, METHOD 213, COND. I

DIELECTRIC WITHSTANDING: 1500 VRMS @ SEA LEVEL

CONNECTOR INTERFACE: DIMENSION PER MIL-STD-348A

TERMINATION STYLE: CABLE CONTACT-SOLDER OR CRIMP

THERMAL SHOCK: MIL-STD-202, METHOD 107, COND. B CORROSION: MIL-STD-202, METHOD 101, COND. B MOISTURE RESISTANCE: MIL-STD-202, METHOD 106

CENTER CONTACT: BERYLLIUM COPPER PER ASTM B196

MOUNTING SEAL: SILICONE RUBBER PER ZZ-R-765

FERRULE-CRIMP

© 500 VOLTS DC

FIGURE 501-2 (BNC)

INSULATION RESISTANCE: 5000 MEGOHMS MINIMUM

FREQUENCY RANGE: 0-4 GHz

CABLE RETENTION: 15 LBS

BODY: BRASS PER ASTM B16

ENVIRONMENTAL

.221 MAX

SPECIFICATIONS

ELECTRICAL

D

This print and associated documents and the contained information are the confidential property of ELECTRONIC CABLE SPECIALISTS. Disclosure of, and/or reproduction of, all or part thereof or manufacture of any part from information contained on this print not specifically permitted by ELECTRONIC CABLE SPECIALISTS in writing is forbidden.

INSTALLATION INSTRUCTIONS

1. BEGIN BY CUTTING THE CABLE OFF SQUARE

REVISIONS ECN ZONE REV. DESCRIPTION DATE APPROVED 14018l IN/C NEW RELEASE 7/23/01 C CHAPMAN .18/ML Α CHANGED STIFFENER AND STRIPPING DIM.S

CABLE CONTACT DIELECTRIC STIFFENER **FERRULE** ा । -.480 --

BODY

DIMENSIONS

MOUNTING SEAL


LK WASHER

2. STRIP THE CABLE AS SHOWN, BEGINNING WITH L1 AND ENDING WITH L2. TAKE CARE NOT TO NICK THE CONDUCTORS WHILE STRIPPING THE DIELECTRIC AND JACKET. THE USE OF A STRIPPER DESIGNED FOR COAXIAL CABLE IS RECOMMENDED.


ั้90°

- L1 = .\25 L2 = .70


SLIDE THE FERRULE AND ADHESIVE SHRINK TUBING OVER THE END OF THE CABLE.

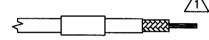


USING TWEEZERS, FOLD THE OUTER BRAID BACK OVER THE CABLE JACKET, LEAVING AS MUCH WEAVE AS POSSIBLE.

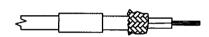

SLIT FOIL LONGITUDINALLY AND FOLD BACK OVER THE OTHER SHIELD.

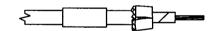


REMOVE THE DIELECTRIC FROM THE CENTER CONDUCTOR BACK APPROXIMATELY .60 INCHES FROM THE END OF THE CONDUCTOR. BE CAREFUL NOT TO NICK THE CENTER COMDUCTOR. THERMAL STRIPPERS ARE RECOMMENDED. LEAVE APPROXIMATELY .09 INCHES OF DIELECTRIC ON THE CABLE FOR THE CUP IN THE STIFFENER.

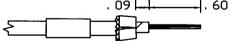


INSTALL DIELECTRIC STIFFENER OVER CENTER CONDUCTOR AND THE CABLE DIELECTRIC MAKING SURE THAT CABLE DIELECTRIC IS FULLY SEATED INSIDE CUPPED END OF DIELECTRIC STIFFENER.


9. SLIDE THE BODY OF THE CONNECTOR OVER THE END OF THE CABLE UNTIL THE NOTCH IN THE CONTACT SEATS INTO THE RIDGE INSIDE THE CONNECTOR DIELECTRIC. CAUTION: PUSH CABLE INTO THE CONNECTOR STRAIGHT TO AVOID KINKING THE CABLE.

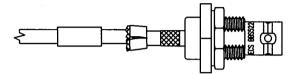

10. FOLD BOTH SHIELDS BACK OVER THE NECK OF THE CONNECTOR BODY.

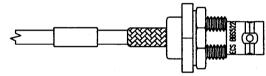

11. SLIDE THE FERRULE UP OVER THE SHIELDS AND AGAINST THE CONNECTOR BODY. TRIM AWAY ANY EXCESS BRAID. CRIMP THE FERRULE ONCE. NEXT TO THE BODY, USING A M22520/5-09 DIE (A HEX) IN A M22520/5-01 TOOL FRAME. APPLY ADHESIVE HEAT SHRINK.

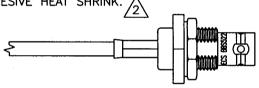

NOTES

/1\ ENSURE HEAT SHRINK IS INSTALLED PRIOR TO CRIMPING CONNECTOR.


ADHESIVE HEAT SHRINK SHOULD BE APPLIED IN ACCORDANCE WITH ECS WORK INSTRUCTION WI007. CONTACT ECS FOR A COPY OF THIS WORK INSTRUCTION.

CONNECTOR DIMENSIONS ARE FOR REFERENCE ONLY.

/4\ INSTALL MOUNTING SEAL, LOCK WASHER AND JAM NUT IN ORDER SHOWN.

8. ENSURE THAT THE CONTACT IS BUTTED AGAINST THE DIELECTRIC STIFFENER. TERMIANTE CONTACT USING METHOD A OR B.

- a) SOLDER CONTACT ONTO CENTER CONDUCTOR, PER MIL-STD-2000, USING 63Sn/37Pb SOLDER. CLEAN FLUX RESIDUE USING APPROPRIATE CLEANER.
- b) CRIMP CONTACT ONTO CENTER CONDUCTOR USING A M22520/5-09 DIE (B HEX). IN A M22520/5-01 TOOL FRAME

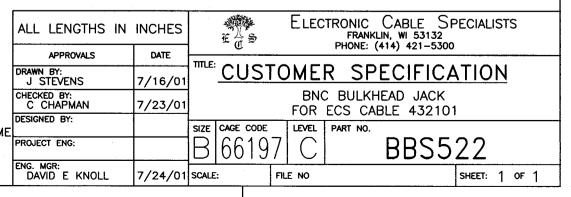

FINISHES BODY. FERRULE:

MATERIALS

BRIGHT NICKEL PER QQ-N-290

CENTER CONTACT: GOLD PER MIL-G-45204

FERRULE: ANNEALED, BRASS PER ASTM B16 OR

COPPER PER ASTM B124

DIELECTRIC: TEFLON PER ASTM D1710